
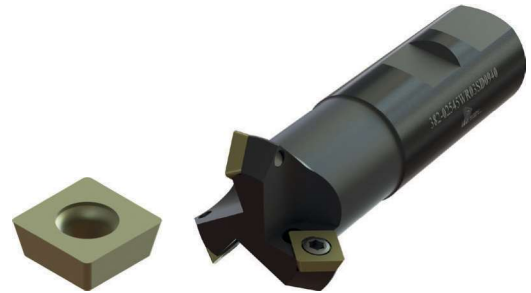


Фрезы с пластиной SDCW

Фрезы концевые для снятия фасок

Фаски $f = 45^\circ$



Фрезы с СМП

Схема	Обозначение	D	D ₁	a	φ	l	L	d	КМ	СМП	z
	380-01645WR01SD0927	16	28,8	6,70	45	27	75	16	-	SDCW 09...	1
	380-02045WR02SD0932	20	32,8	6,70	45	32	82	20	-		2
	380-02545WR03SD0940	25	37,8	6,70	45	40	96	25	-		3
	386-01645MKR01SD0927	16	28,8	6,70	45	27	96	-	2	SDCW 09...	1
	386-02045MKR02SD0932	20	32,8	6,70	45	32	118	-	3		2
	386-02545MKR03SD0940	25	37,8	6,70	45	40	126	-	3		3
ТУ 25.73.40-008-36293294-2018											

Пластины

Схема	Обозначение	iC	a	s	α	d ₁	r
	SDCW 090308 TN	9,525	9,525	3,18	15	4,4	0,8

Винты

Схема	Обозначение	d	L	Размер Torx
	ST-40090-UX	M4,0-6g	9	15 IP

Фрезы с пластиной SPCW

Фрезы концевые для снятия фасок

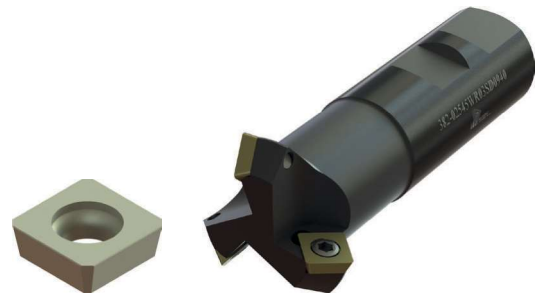

 Фаски $f = 45^\circ$


Схема	Обозначение	D	φ	a	D ₁	l	L	d	КМ	СМП	z
	381-03245WR03SP1240	32	45	9,00	49,3	40	100	32	-	SPCW 12...	3
	381-03230WR03SP1240	32	30	6,35	53,2	40	100	32	-		3
	381-03260WR03SP1240	32	60	11,00	44,3	40	100	32	-		3
	387-03245MKR03SP1240	32	45	9,00	49,3	40	126	-	3	SPCW 12...	3
	387-03230MKR03SP1240	32	30	6,35	53,2	40	126	-	3		3
	387-03260MKR03SP1240	32	60	11,00	44,3	40	126	-	3		3

ТУ 25.73.40-008-36293294-2018

Фрезы торцовые для снятия фасок

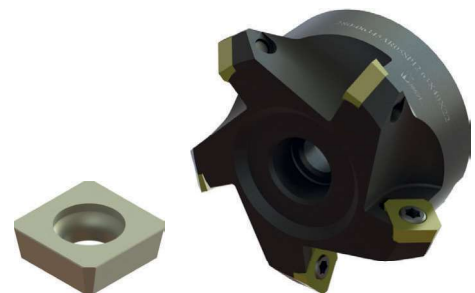

 Фаски $f = 45^\circ$


Схема	Обозначение	D	a	H	d	B	t	СМП	z
	280-04045AR03SP12	40	8	40	16	8,4	5,6	SPCW 12...	3
	280-05045AR04SP12	50	8	40	22	10,4	6,3		4
	280-06345AR05SP12	63	8	40	22	10,4	6,3		5

ТУ 25.73.40-025-36293294-2018

Пластины

Схема	Обозначение	iC	a	s	α	d_1	r
	SPCW 120408 TN	12,700	12,700	4,76	11	5,5	0,8

Винты

Схема	Обозначение	d	L	Размер Torx
	ST-50110-SC	M5,0-4h	11	15 IP
	ST-50120-UX	M5,0-5h	12	20 IP