

Фрезы для снятие фасок

Цилиндрический хвостовик

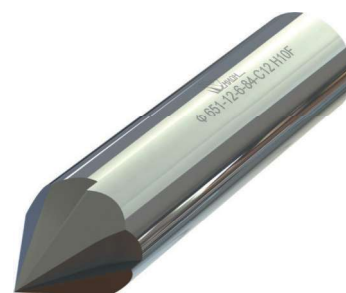




Схема	Обозначение	D	l	L	d	z	
	$\alpha^\circ = 90^\circ$						
	Ф 651-6-3-58-C6	6	3	58	6	4	
	Ф 651-8-4-64-C8	8	4	64	8	4	
	Ф 651-10-5-73-C10	10	5	73	10	4	
	Ф 651-12-6-84-C12	12	6	84	12	4	
	$\alpha^\circ = 60^\circ$						
	Ф 652-6-5,1-58-C6	6	5,1	58	6	4	
	Ф 652-8-6,9-64-C8	8	6,9	64	8	4	
	Ф 652-10-8,6-73-C10	10	8,6	73	10	4	
	Ф 652-12-10,3-84-C12	12	10,3	84	12	4	
	Группа применения						
	P	M	K	N	S	H	
<input checked="" type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>		
ТУ 25.73.40-039-36293294-2019							